



UNIVERSITY

LEVEL 2, LESSON 1

BASICS OF ACCELEROMETER MOUNTING AND INSTALLATION

Introduction



Welcome to Level 2, Lesson 1 – Basics of Accelerometer Mounting and Installation, part of CTC's free online vibration analysis training series.

We hope you enjoyed and benefitted from the previous Level 1 Introduction course and will continue to build your vibration analysis knowledge as you progress through Level 2.

Basics of Accelerometer Mounting and Installation is created and presented by CTC for complimentary educational use only. This training presentation may not be edited or used for any other purpose without express written consent from CTC.



Training Objectives

This training will focus on the following accelerometer installation techniques:



Upon completion of this lesson, you will:



Understand the advantages and disadvantages inherent in the various mounting methods for your accelerometer or Piezo velocity sensor



Be able to determine which mounting hardware and technique to utilize based on the type of data you require for a given application



Four Mounting Styles

There are four general categories of mounting styles:



Magnet Mounting with a curved surface magnet



Specialty Mounting Pads

such as motor fin mount pads



Epoxy Pads

including quick disconnect studs, targets for flat magnets, and permanent mounting studs





Advantages And Limitations Of Mounting

There are pros and cons to each method of sensor mounting.

Typically, an analyst will capture better data when the mounting method:

Adds minimal mass (weight)

Maximizes surface area contact

Maximizes stiffness

Is located closer to the source of the vibration

The charts on the following slides will use this rating system:





Portable Mounting – Advantages And Limitations





Portable Mounting – Advantages And Limitations



The area of a curved surface (or 2-bar) magnet is not as good as a quick disconnect system or a flat magnet with a target, and its mass tends to be higher; therefore, analysts should not depend on data above 2 kHz (120,000 CPM)

A flat magnet on a well-installed target (as shown on the left) can yield reliable data up to 8 kHz and possible 10 kHz (600,000 CPM)

Similarly, because the quick disconnect system and the flat magnet with target system both utilize a component which stays attached to the machinery between route collections, the data is very repeatable - same point, same angle

Any analyst who has used a curved surface magnet knows that it is among the easiest methods of data collection available



Portable Or Permanent Mounting – Advantages And Limitations





Portable Or Permanent Mounting – Advantages And Limitations

Specialty mounts such as Zerk adapters, also known as grease fitting adapters (shown on the left) and motor fin mount pads tend to add a bit of mass and lack some stiffness

Regardless, they tend to provide good data, usually in the 2 kHz to 5 kHz (120,000 to 300,000 CPM) range, because they are positioned in good proximity to the source of the bearing vibration

This method also tends to be very repeatable since the accelerometer mounting area on top of the pad will either attract a magnet for repeatable measurements, or will accept the stud for permanent mounting

Ease of installation varies



Permanent Mounting – Advantages And Limitations





Permanent Mounting – Advantages And Limitations



Assuming proper techniques are used to mill the surface and affix the sensor, permanent mounting options tend to produce good results at higher frequency ranges (up to the full useful range of the sensor)

Data will typically be cleaner, more accurate, and highly repeatable

To achieve these results, the initial installation requires more care and more time compared to some portable methods

Permanent mount installations also tend to be more expensive initially, due to dedicating a sensor to each mounting point. However, the initial investment is negated when analysts can get better data more efficiently, resulting in better decision making and less downtime

All the methods discussed thus far have their place in a vibration monitoring program - it is up to the analyst to determine the best method for the specific application



Installation And Mounting – Techniques

After an analyst decides which mounting hardware is best for the application, it is important that the proper technique for mounting the sensor and/or pad is used to ensure that the analyst can get the most out of the data collected.

Likewise, improper technique in mounting the hardware will result in data which is unclear, or possibly only a partial indication of what is happening with the application. Sometimes, improper technique can even damage the sensors or cables, leading to eventual loss of good, consistent data.

The rest of this lesson will focus on the proper techniques for the most common mounting options.





Installation And Mounting – Things To Remember

Proper permanent installation of mounting hardware or sensors on an application seeks to accomplish several things, including:

Maximize frequency response

Maximize data quality

Ensure long-term adhesion



Installation And Mounting – Things To Remember

To maximize frequency response and data quality, an analyst should:





Installation And Mounting – Things To Remember

To ensure long-term adhesion, an analyst should:

Use proper surface preparation

Use materials compatible with the environment in which the application will be running



Installation And Mounting – Tools

As with most jobs, the right tools will make a difference in the quality of your installation

The tools you may need are pictured on the right

.....





Installation And Mounting – Stud Mounting Advantages



Stud mounting your sensor directly to the machine offers several advantages:

Provides the best transmission of the broadest range of frequencies (when properly installed) and should allow the analyst to use the sensor's full frequency range

Provides the most reliable and resilient information

Meets intrinsically safe requirements since the case of the sensor must be grounded to the machinery when used in an explosive area (note, special sensors and barriers must be used in such applications)



Installation And Mounting – Stud Mounting Procedure





Adhesive Mounting – Epoxy Pads

Epoxy pads are a good solution where a magnet target is desired

Magnet targets are used to improve the consistency of the data being analyzed by ensuring data is taken from the same point on each 'route,' regardless of who is collecting the data

Targets are also useful for analysts who are using flat magnets to collect higher frequency data – the polished, flat surface provides better transmission of data over 5 kHz (300,000 CPM)

Epoxy pads are also frequently used for permanent mounting of sensors where drilling and tapping are not permitted or possible

Properly installed epoxy pads can transmit high frequency data (10 kHz or 600,000 CPM) very well, and therefore can be used effectively for monitoring many gearbox and bearing faults

Avoid using them in cooling towers or other aggressive environments that could interfere with the bonding of the adhesive



MH102-1A Epoxy Pad



MH150-1A Magnet Target



Adhesive Mounting Pads On Milled Surface Procedure

Using even pressure, drill a flat surface the same diameter as the mounting pad using an MH117 right angle drill with end-mill bit, or a grinding tool The pilot drill bit in the end-mill should only be set slightly below the mill, just enough to catch the surface and prevent the mill from skating sideways Clean the target surface area and that of the pad with acceptable, residue-free solution (like Windex). Be sure to wear clean rubber gloves to prevent transferring oils and contaminants from your hands. Apply a thin layer of adhesive (such as Loctite 330) to the pad. Make sure the adhesive is compatible with all your environmental factors including chemicals, moisture and heat.





Adhesive Mounting Pads On Unmilled Surface Procedure

Note: Mounting on an unmilled surface will cause a loss of some of the higher frequency signals, however sometimes it is the only choice

Mix a gap filling epoxy, like Devcon Apply a thick layer of adhesive on Clean the target surface area and Plastic Welder, on a clean surface the mounting surface of the pad that of the pad with acceptable, or in an applicator gun. Make sure residue-free solution (like Windex). the adhesive is compatible with Be sure to wear clean rubber gloves environmental factors like to prevent transferring oils and contaminants from your hands. chemicals, moisture and heat. 5 6 Paint any exposed metal on the Push the pad onto the mounting Tape the pad in place while the surface of the machine to prevent surface of your application and hold adhesive cures in place for 30 seconds to allow corrosion epoxy to begin to set



Adhesive Mounting – Motor Fin Mount Pads



To monitor outboard bearings which are covered by an end-bell, analysts should consider using motor fin mount pads

Motor fin mount pads deliver the vibration signal from the bearings through the housing of the motor, avoiding resonant frequencies which would be encountered if collecting data from the end-bell or top of the motor fins



Installation And Mounting – Motor Fin Pad Mounting Procedure

Scrape fins and valley with end of file and/or wire wheel to bare metal



Clean the surface with acceptable, residue-free solution (like Windex).

Choose the correct size MH118 fin mount so that the bottom of the probe will be seated in the valley of the fin, while the pad remains clear of the top of the motor fin While wearing disposable gloves, apply a generous amount of epoxy to the pad. Be sure to use an epoxy that sets up hard, with good gap filling properties, like Devcon Plastic Welder



Insert the probe portion of the fin mount pad between the fins, close to the source of the vibration you are targeting (typically as close to the bearing race as possible without touching the end-bell)



Be sure to seat the bottom of the probe in the valley of the motor fin. It is important that the probe base maintains contact with the motor fin valley, otherwise data will include additional resonances from the fins Tape the pad in place while the epoxy cures





Magnet Mounting – Curved Surface Magnets

When using a magnet for portable data collection, the proper technique is to rock the magnet onto and off the mounting surface

Failure to rock the sensor onto the surface can produce very high g levels in the sensor. These high g levels can overload the amplifier in the sensor, causing the sensor to overload or saturate, resulting in data commonly referred to as ski slope.

Ski sloping causes the low frequency data to register such high amplitudes that no other data is visible on the analyzer

Gently rocking the sensor onto the mounting surface prevents this sudden shock to the sensor and allows the sensor and analyzer to settle more quickly so that accurate data can be obtained





Magnet Mounting – Curved Surface Magnets



Don't allow your sensor to be slammed onto the mounting surface

The resulting ski slope or overload condition which may be caused by the shock to the sensor will yield erroneous data and will prolong your route collection time

Repeated shock to the sensor could also permanently damage your sensor

Remember that your sensor and data collector are precision tools which must be handled with care to ensure that your data is consistently accurate



Please take a moment to review the following examples of mounting techniques and positions



Permanent Mounting – Example 1: Motor And Fan



Horizontal



Permanent Mounting – Example 2: Fan



Vertical

Axial



Permanent Mounting – Example 3: Motor

Vertical mount on a grease fitting adapter

Horizontal mount on a quick disconnect

Axial mount on an epoxy pad







Permanent Mounting – Example 4: Cooling Tower Gearbox





Why Choose CTC?



Superior durability



Accuracy and performance



Industry's best lead times



Knowledgeable staff



Industry leading warranties



Connect With CTC

We look forward to hearing from you



